



Datasheet



0370 330 6021

www.sunbeltrentals.co.uk

New Fluke 287

True-rms Electronics Logging Multimeter with TrendCapture


Technical Data

The advanced, logging digital multimeter with high accuracy and TrendCapture electronics professionals can depend on.

The Fluke 287 True-rms Electronics Logging Multimeter with TrendCapture quickly documents design performance and graphically displays what happened. Its unique logging and graphing capabilities mean you no longer need to download logged readings to a PC to detect a trend. The Fluke 287 packs more accuracy and convenience into a handheld multimeter than ever before.

Equipped with new functionality

- **New** – Large 50,000 count, 1/4 VGA display with white backlight. Multiple sets of measurement information can be simultaneously displayed at the same time.
- **New** – Logging function with TrendCapture. Useful for characterizing the performance of a design or for unattended monitoring while in the field. Users can review logged readings without needing a PC.
- **New** – **i** button. On board help screens for measurement functions
- **New** – Saved measurements allow you to name and recall measurements made in the field
- **New** – Multi-lingual interface

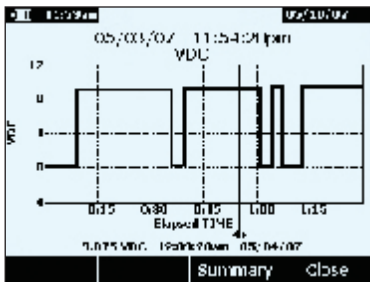

TrendCapture displays vDC logged date.

- Multiple logging sessions possible without download
- 0.025 % basic dc accuracy
- 100 kHz ac bandwidth
- Real time clock for automatic time stamping of saved readings
- True-rms ac voltage and current for accurate measurements on complex signals or non linear loads. AC bandwidth specified to 100 kHz.
- Measure up to 10 A (20 A for 30 seconds)
- 100 mF capacitance range
- Temperature function
- Relative mode to remove test lead resistance from low ohms or capacitance measurements
- Peak capture to record transients as fast as 250 μ s
- Premium test leads and alligator clips included
- Optional FlukeView forms enables you to document, store and analyze individual readings or a series of measurements, then convert them into professional-looking documents
- Optional magnetic hanger allows you to hang the meter for easy viewing while freeing your hands to focus on the job
- Limited lifetime warranty



Specifications

Function	Range and Resolution	Basic Accuracy
DC volts AC volts	50.000 mV, 500.00 mV, 5.0000 V, 50.000 V, 500.00 V, 1000.0 V	0.025 % 0.4 % (true-rms)
DC current AC current	500.00 µA, 5000.0 µA, 50.000 mA, 400.00 mA, 5.0000 A, 10.000 A	0.15 % 0.7 % (true-rms)
Temperature (excluding probe)	-200.0 °C to 1350.0 °C (-328.0 °F to 2462.0 °F)	1.0 %
Resistance	500.00 Ω, 5.0000 kΩ, 50.000 kΩ, 500.00 kΩ, 5.0000 MΩ, 50.00 MΩ, 500.0 MΩ	0.05 %
Capacitance	1.000 nF, 10.00 nF, 100.0 nF, 1.000 µF, 10.00 µF, 100.0 µF, 1000 µF, 10.00 mF, 100.0 mF	1.0 %
Frequency	99.999 Hz, 999.99 Hz, 9.9999 kHz, 99.999 kHz, 999.99 kHz	0.005 %

Additional Functions/Features	Fluke 287
Multiple on screen displays	Yes
True-rms ac bandwidth	100 kHz
dBV/dBm	Yes
DC mV resolution	1 µV
Megohm range	up to 500 M
Conductance	50.00 nS
Continuity beeper	Yes
Battery/fuse access	Battery/fuse
Elapse time clock	Yes
Time of day clock	Yes
Min-max-avg	Yes
Peak	250 µS
Duty cycle	0.01 % to 99.99 %
Pulse width	0.025 ms, 0.25 ms, 2.5 ms, 1250.0 ms
Hold	Yes
Isolated optical interface	Yes
Auto/touch hold	Yes
Reading memory	Yes
Log to PC	Yes
Interval/event logging	Yes
Logging memory	up to 10,000 readings

Ordering information

287 True-rms Electronics Logging Multimeter with TrendCapture

Optional accessories

FVF-SC2 FlukeView® Forms Software with Cable
 80BK Integrated DMM Temperature Probe
 TLK287 Electronic Test Lead Set
 TPAK Magnetic Hanging Kit
 C280 Soft Case

Fluke. Keeping your world up and running.®

General specifications

Maximum voltage between any terminal and earth ground: 1000 V

Battery type: 6 AA alkaline batteries, NEDA 15A IEC LR6

Battery life: 100 hours minimum, 200 hours in logging mode

Temperature:
 Operating: -20 °C to 55 °C
 Storage: -40 °C to 60 °C

Relative humidity: 0 to 90 % (0 to 37 °C), 0 to 65 % (37 °C to 45 °C), 0 to 45 % (45 °C to 55 °C)

Electromagnetic compatibility: EMC EN61326-1

Vibration: Random vibration per MIL-PRF-28800F Class 2

Shock: 1 meter drop per IEC/EN 61010-1 2nd Edition

Size (HxWxL): 22.2 cm x 10.2 cm x 6 cm (8.75 in x 4.03 in x 2.38 in)

Weight: 870.9 g (28 oz)

Fluke Corporation
 PO Box 9090, Everett, WA USA 98206

Fluke Europe B.V.
 PO Box 1186, 5602 BD Eindhoven, The Netherlands

For more information call:
 In the U.S.A. (800) 443-5853 or Fax (425) 446-5116
 In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222
 In Canada (800)-36-FLUKE or Fax (905) 890-6866
 From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116
 Web access: <http://www.fluke.com>

©2007 Fluke Corporation. All rights reserved. Specifications subject to change without notice. Printed in U.S.A. 5/2007 11285-ENG Rev. 01

We are supporting you to deliver
a world class service, every day,
in every sector...

LOCATIONS

LONDON, HEATHROW

Sunbelt Rentals UK Test & Monitoring

242-252 London Road, Staines, London TW18 4JQ

0333 122 3126

www.sunbeltrentals.co.uk/find-a-depot/london-heathrow

REDCAR

Sunbelt Rentals UK Test & Monitoring

Unit 5 Kirkleatham Business Park, Redcar TS10 5SQ

0370 330 6021

www.sunbeltrentals.co.uk/find-a-depot/teesside

STOKESLEY

Sunbelt Rentals UK Test & Monitoring

2 Ellerbeck Way, Stokesley Business Park, Stokesley, North Yorkshire TS9 5JZ

01642 718 900

www.sunbeltrentals.co.uk/find-a-depot/stokesley



www.inlec.com

Order Online with Next Day
Delivery, Online Chat & Online
Account Management



★ Trustpilot

View our trustpilot score



STOKESLEY  REDCAR

 HEATHROW

0370 330 6021

instrumentation@sunbeltrentals.co.uk

testequipment@sunbeltrentals.co.uk

www.sunbeltrentals.co.uk

