

# Datasheet





0370 330 6021 www.sunbeltrentals.co.uk

# MOM2

# **Micro-ohmmeter**



- Up to 240 A
- Bluetooth® headset for audible pass/fail testing against adjustable limits
- Battery powered
- Handheld, lightweight 2.2 lb (1 kg)
- Safe test DualGround™
- Auto range: 1  $\mu\Omega$  to 1000 m $\Omega$
- Ultra capacitor technology (patent pending)

#### **DESCRIPTION**

The MOM2 Micro-ohmmeter is a lightweight, handheld unit designed to deliver up to 240 Amps and measure the resistance of circuit breaker contacts, bus-bar joints, and other high-current links. This product is designed with safety, ease of use and versatility in mind.

The MOM2 can be used anywhere to measure a low resistance value with high accuracy. With the MOM2, it is possible to make measurements according to the DualGround<sup>TM</sup> method. This means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow.

Its ruggedness and light weight make the MOM2 very suitable for field work, such as in substations. The unit comes with a strong rubber holster accessory which makes it extra durable. The MOM2 is capable of testing for a full day without recharge. It can store 190 test values and transfer test data to a PC via Bluetooth.

The Bluetooth feature can also be used in conjunction with the wireless headset to provide an audible pass/fail signal against user-adjustable limits as tests are performed.

#### **High Current Generation Using Ultra Capacitor**

The MOM2 uses an ultra capacitor to generate the high-output current. Ultra capacitors are able to store huge amounts of energy compared to conventional capacitors. In addition, they can deliver very high currents during discharge as a result of their very low internal resistance.

While testing, the capacitor is discharged through the test object. The voltage drop across and the current flow through the test object are continuously and synchronously sampled. The resistances calculated from the individual samples are then averaged to obtain the final value.

#### **APPLICATIONS**

The MOM2 test system is designed to serve a number of applications. The most common are contact resistance measurements of low-, medium- and high-voltage breakers and also at bus-bar joints, and other high current links.

If the contact resistance is too high, this will lead to power loss and temperature rise, which often leads to serious trouble. To avoid such problems, it is necessary to check the resistance at regular intervals.

The following table demonstrates how important low resistance is at high currents:

Current	Contact resistance	Power loss
10 kA	1 mΩ	100 kW
10 kA	0.1 mΩ	10 kW
1 kA	1 mΩ	1 kW
1 kA	0.1 mΩ	100 W

At 10 kA a contact with the resistance 0.1 m $\Omega$  gives a power loss of 10 kW. This power loss in one single point will definitely confer a temperature rise, which may result in overheating and possibly premature failure.

# Handheld High Current Micro-ohmmeter

# Megger.

# **INSTRUMENT FRONT VIEW**


- 1. Current output terminal (-)
- 2. Current output terminal (+)
- 3. Display
  - The display offers a combination of analog arc and a dual digital readout:
  - Analog arc: Indicates level of the capacitor charge.
  - Dual digital display: Large main digital readout for good visibility of all main measurement results Second digital display for additional data.
- 4. Ground (earth) terminal
- 5. Keys for navigation and to make settings in the display
- 6. TEST-button
- 7. Stand-by/Wake up (Press shortly to toggle) Clear log (Press and hold for 5 seconds)
- 8. Function selector

OFF			
	0.1 s	Measurement time with minimum current guarantee	
I > I min	0.6 s		
	3 s		
	0.1 s	Measurement time with max. charge	
I = I max	0.6 s		
	3 s		
SET	8	Bluetooth "pair units"	
	CLK	Set date and time	
		Set volume for the internal loudspeaker	
		Discharge the MOM2 internal capacitor	
	I min	Minimum current guarantee setting	
	LOG	Data log setings	
	P/F	Pass/Fail settings	
PC COM		PC communication (dump data to PC)	
USER	1 2	Stored settings. Set from PC, MOM2 Win	
	3		

- **9.** Connector for the voltage (–) sense lead
- 10. Connector for the voltage sense (+) lead and the trig function
- 11. Connector for the battery charger
- 12. Battery charger indicator



## 4 wire Kelvin test

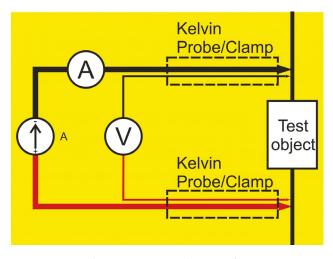

The Kelvin probes (included in BD-59090) are used for a 4-wire Kelvin test. This is a way of measuring continuity resistances ensuring all contact and lead resistances are compensated for, allowing a much greater accuracy in measurements. Each Kelvin probe assembly has two probe tips: one tip is for the current generated; the other will measure the very small voltage present. The Kelvin clamps (included in BD-59092) use the same principle.



The "double" probe tip showing the springy center tip

# Megger.

## **APPLICATION EXAMPLES**

#### **Circuit Breaker testing**

- Test of circuit breaker contacts
- Test of the connections to the breaker

## **Testing of Bus-bar**


- Test of Bus-bar joints
- Test of connections

# Everywhere you need to test a low resistance/ high current connection

- Switches
- Disconnecting devices
- Safety ground connections
- Welding points
- Fuses
- Cables



Hold probes / attach Kelvin clamps to CB and press trig / TEST button. A signal indicates whether test was pass or fail and result is logged in unit for later dump to PC.

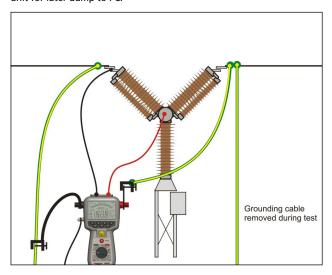

Traditional measurement from ground. Injection is done through existing grounding cable (earthing). Optional cable kit is needed. Available kits have 5, 10 or 15 m cables.

## **BOTH SIDES GROUNDED**


Within electrical power utilities, switchgear owners and service companies, there is an increased emphasis on efficiency of operations, maintenance and service levels. There is an increased emphasis on health, safety, and environmental compliance. Experience has also shown demands for shorter time periods for testing, while the switchgear is less and less available to be taken out of service.

Many utilities require safety grounds to remain in place during station outages, and the MOM2 was designed with this field safety constraint in mind. DualGround means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow. Minimum time is spent in the substation and focus is on the test rather than the equipment.

Conventional vs. DualGround				
Site preparation (isolate work area, apply safety ground, issue permit to work)	Site preparation (isolate work area, apply safety ground, issue permit to work)			
Hook up test equipment. Issue sanction for test	Hook up test equipment. Issue sanction for test			
Authorized person removes the ground	Risky step left out			
Perform testing	Safe testing with both sides grounded			
Authorized person applies ground	Risky step left out			
Cancel sanction for test. Disconnect test equipment	Cancel sanction for test. Disconnect test equipment			
Site closing (cancel permit to work, disconnect ground)	Site closing (cancel permit to work, disconnect ground)			



Equipment and methods that supports DualGround™ testing are associated with the DualGround symbol. This symbol certifies the use of groundbreaking technology and methods that enables a safe, fast and easy workflow with both sides grounded throughout the test.

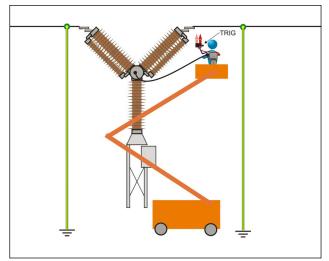

 $\label{thm:measurement} \mbox{Measurement on CB with both sides grounded, Dual Ground.}$ 



# Handheld High Current Micro-ohmmeter

#### **SPECIFICATIONS**

Specifications are valid at fully charged batteries and an ambient temperature of +25°C, (77°F). Specifications are subject to change without notice.

#### **Environment**

Application field For use in high-voltage substations and

industrial environments.

Temperature

Operation\*  $-20^{\circ}\text{C to } +50^{\circ}\text{C } (-4^{\circ}\text{F to } +122^{\circ}\text{F})$ Storage  $-40^{\circ}\text{C to } +70^{\circ}\text{C } (-40^{\circ}\text{F to } +158^{\circ}\text{F})$ 

Relative humidity %RH 5%-95%, non condensing

Pollution degree 2

Shock IEC 60068-2-27 Vibration IEC 60068-2-6 Transport ISTA 2A

\*Battery operation temperature 0°C to +50° (32°F to +122°F) \*Battery charging temperature +10°C to +40° (50°F to +104°F)

General

Battery power Five AA (HR6) 2700 mAh NiMH cells

Recharge time < 12 h
Typical recharge time at 3 h

25°C

Battery charger

Mains voltage 100-250 V AC, 50 / 60 Hz

Power consumption 60 W

Protection Against wrong battery type, low/high

temperature

Real time clock battery life ≥10 years

Audible feedback Different buzzer sounds

User presets 3
Field calibration Yes
Encapsulation IP54

Dimensions 217 x 104 x 72 mm (excl. binding posts) 8.5 x 4.1 x 2.8 in.

Weight 2.2 lbs (1.0 kg) instrument only

11 lbs (5.0 kg) with accessories and

carrying case

**CE-marking** 

EMC 2004/108/EC LVD 2006/95/EC

**Measurement section** 

Minimum current guarantee Selectable 50 A / 100 A

Valid at resistance  $\leq 2m\Omega$ 

Pass / Fail Settable from 1  $\mu\Omega$  to 1999 m $\Omega$ Number of measurements on fully charged batteries typ. 2200 at I min = 50 A and 0.1 s typ. 800 at I min = 100 A and 0.1 s

Interference suppression Yes

Range  $0 - 1000 \text{ m}\Omega$ 

Range selection Auto

Resolution

 $\begin{array}{lll} 0 - 999 \ \mu\Omega & 1 \ \mu\Omega \\ 1.0 - 9.99 \ m\Omega & 0.01 \ m\Omega \\ 10.0 - 99.9 \ m\Omega & 0.1 \ m\Omega \\ 100 - 1000 \ m\Omega & 1 \ m\Omega \end{array}$ 

Accuracy

 $\begin{array}{ll} 0-1999~\mu\Omega & \qquad \qquad \pm 1~\% ~of ~reading ~\pm 1 ~digit \\ 2-1000~m\Omega & \qquad \qquad \pm 2~\% ~of ~reading ~\pm 1 ~digit \end{array}$ 

Outputs + / -

Range  $> 100 \text{ A DC } (R < 2 \text{ m}\Omega)$ 

Output voltage (max) 2.5 V DC

Generation duration Selectable: 0.1 s, 0.6 s, 3 s

	Recovery time at I min set to 100 A and load 100 $\mu\Omega$		
Generation time	Max	Тур	
0.1 s	10 s	8 s	
0.6 s	20 s	16 s	
3 s	130 s	100 s	

## Inputs

SENSE + / -

Connector 4 mm banana jack Voltage  $\pm 3 \text{ V DC}$ 

Trigger input Threshold 8 V DC
DC IN 12 – 24 V DC, 2 A max

Logger

Logger, Data Label. Timestamp, I max, I min, I Limit,

Resistance, Meas.time, P/F limit

Labeling schemes Circuit breaker oriented or diary number

Capacity 190 measurements

#### **Wireless communication**

Headset Bluetooth PC communication Bluetooth

# Megger.

# **INCLUDED ACCESSORIES**



MOM2 shown with transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win software.

## **OPTIONAL ACCESSORIES**



Bluetooth headset



Bluetooth dongle



Calibration kit



Connection plate, used with the cable kits



Soft carrying case



Kelvin probes (incl. in BD-59090)

ORDERING INFORMATION	
Item	Cat. No.
MOM2 Micro-ohmmeter including: 2 x 1.3 m (4 ft) test cables Kelvin probes (one with trig button) transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59090
MOM2 Micro-ohmmeter including: 1.3 m (4 ft) test cable red with Kelvin clamp 3 m (10 ft) test cable black with Kelvin clamp C/N GA-90001, transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59092
MOM2 Micro-ohmmeter including: 1.3 m (4 ft) test cable red with Kelvin clamp 5 m (16 ft) test cable black with Kelvin clamp, transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59093
Optional Accessories	
Test cables with Kelvin probes 2 x 1.3 m (4 ft) (one with trig button)	GA-90000
Test cables with Kelvin clamps 1.3 m (4 ft) red, 3 m (10 ft) black	GA-90001
Test cables with Kelvin probes 3 m (10 ft) black	GA-00372
Test cables with Kelvin probes 5 m (16 ft) black	GA-00374
Cable kit 5 m  Current cable 0.5 m (1.6 ft), connection plate and sense cables 5 m (16 ft), ground cable	GA-00380
Cable kit 10 m Current cable 0.5 m (1.6 ft), connection plate and sense cables 10 m (33 ft), ground cable	GA-00382
Cable kit 15 m  Current cable 0.5 m (1.6 ft), connection plate and sense cables 15 m (49 ft), ground cable	GA-00384
Bluetooth headset and dongle for PC	XC-06000
Calibration kit	BD-90002
Soft carrying case for MOM2, charger & cables	GD-00620

## UNITED STATES

Megger 2621 Van Buren Avenue Norristown, PA 19403 USA

T +610-676-8500 T +866-254-0962

F +610-676-8625

#### **SWEDEN**

Megger Sweden AB Rinkebyvägen 19 SE-182 36 DANDERYDT +46 8 510 195 00 F +46 8 510 195 95 E seinfo@megger.com

#### Other Technical Sales Offices

Dover UK, Dallas USA, College Station USA, Sydney AUSTRALIA, Ontario CANADA, Trappes FRANCE, Oberursel GERMANY, Aargau SWITZERLAND, Dubai UAE, Mumbai INDIA, Johannesburg SOUTH AFRICA, and Chonburi THAILAND Registered to ISO 9001 and 14001 Subject to change without notice. MOM2\_DS\_US\_V14

www.megger.com Megger is a registered trademark We are supporting you to deliver a world class service, every day, in every sector...

# **LOCATIONS**

# LONDON, HEATHROW

Sunbelt Rentals UK Test & Monitoring

242-252 London Road, Staines, London TW18 4JQ 0333 122 3126

www.sunbeltrentals.co.uk/find-a-depot/london-heathrow

## **REDCAR**

Sunbelt Rentals UK Test & Monitoring

Unit 5 Kirkleatham Business Park, Redcar TS10 5SQ 0370 330 6021

www.sunbeltrentals.co.uk/find-a-depot/teesside





# **STOKESLEY**

Sunbelt Rentals UK Test & Monitoring

2 Ellerbeck Way, Stokesley Business Park, Stokesley, North Yorkshire TS9 5JZ 01642 718 900

www.sunbeltrentals.co.uk/find-a-depot/stokesley



www.inlec.com

Order Online with Next Day Delivery, Online Chat & Online **Account Management** 





View our trustpilot score











